
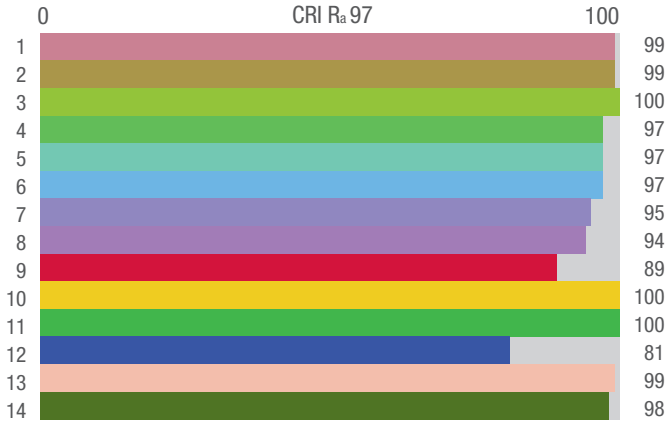
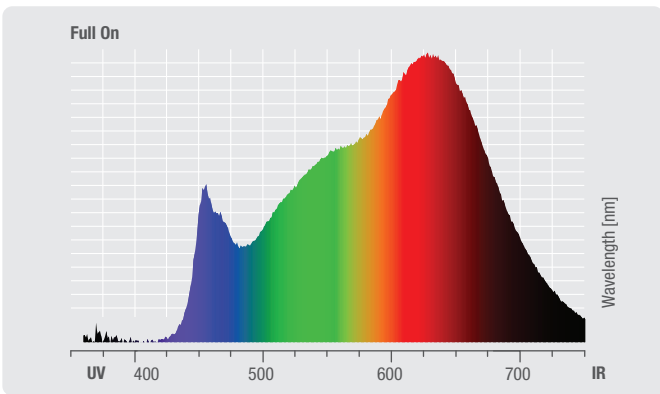
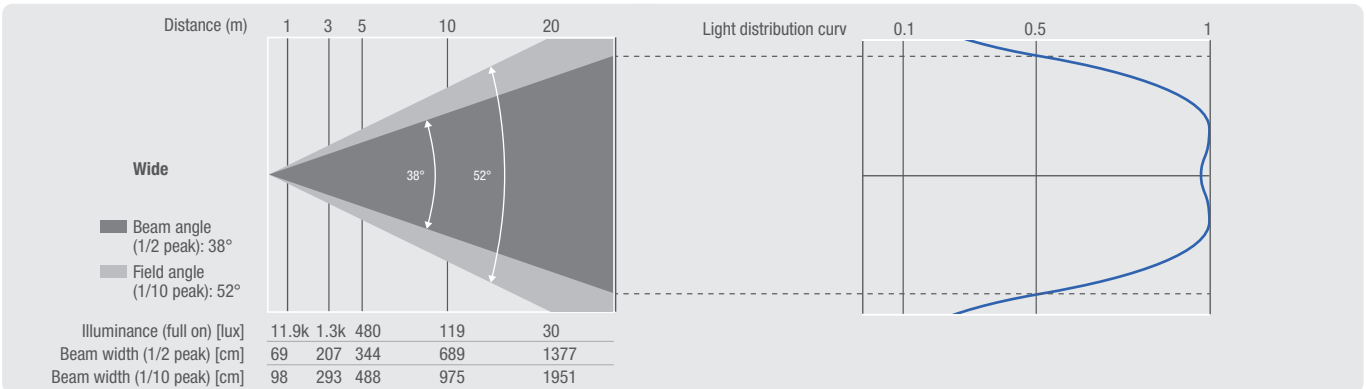


Photometric Measurements

Photometrische Messungen | Mesures Photométriques
 Mediciones Fotométricas

TS 100 WW (CLTS100WW)


	Luminous flux narrow (wide)	Chromaticity coordinates	CCT	R _a
Full on	3700 lm (4100 lm)	x 0.435 y 0.403	3015 K	97

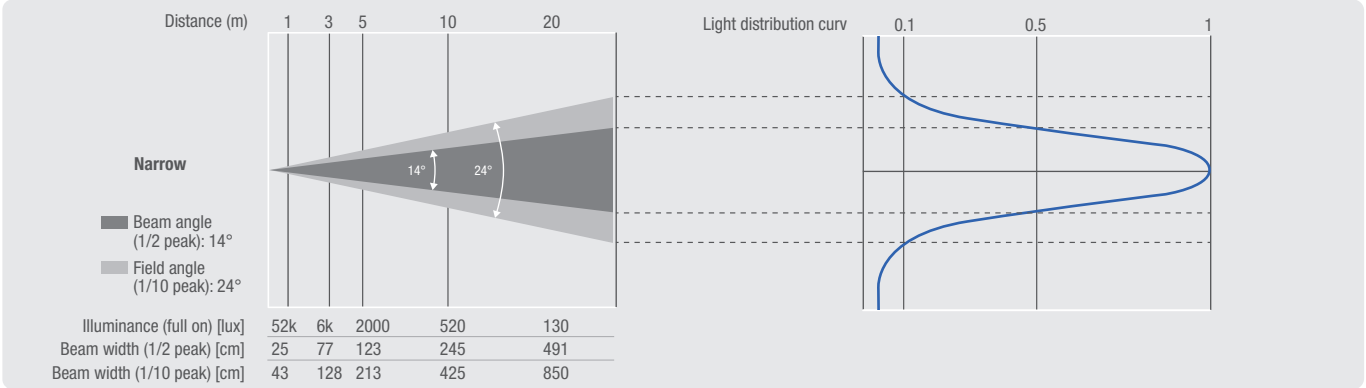


3200K Television Lighting Consistency Index-2012

CCT = P3007 (-0.0)

TLCI-2012: 97 (P3007)

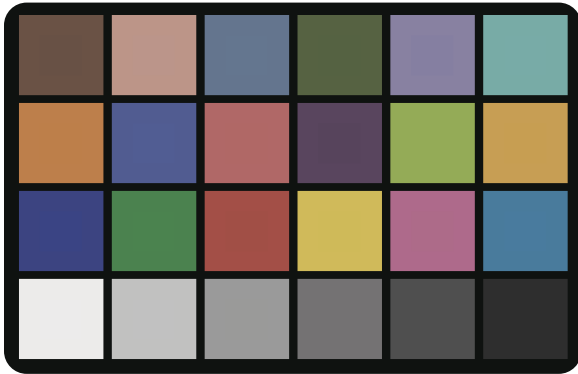

Sector	Lightness	Chroma	Hue
R	0	0	0
R/Y	0	0	0
Y	0	0	0
Y/G	0	0	0
G	0	0	0
G/C	0	0	0
C	0	0	0
C/B	0	0	-
B	0	0	0
B/M	0	0	+
M	+	+	0
M/R	+	0	0

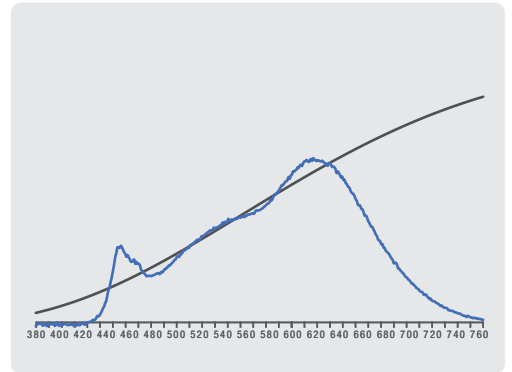

TM-30-15 R_f 91
 R_g 98

